

**X-TYPE**

DATE 03/02

XT418-S918**SERVICE****TECHNICAL BULLETIN**

Fuse Rating Change From 30 to 15 Amp –
Ignition Supply –
Service Action S918

MODEL 2002 MY
X-TYPE
VIN C00344-C36947

Issue:

On manual transmission X-TYPE vehicles, within the above VIN range, the ignition supply fuse located in the power distribution fuse box is over rated and does not provide adequate protection for the circuit involved.

Action:

At the next service opportunity, replace the ignition supply fuse with a lower rated fuse on 2002 MY manual transmission X-TYPE vehicles within the above VIN range.

PROCEDURE

1. Open hood and fit fender protector covers.
2. Disconnect vehicle battery.
3. Displace and remove engine compartment fuse box cover.
4. Displace and remove 30 amp fuse (ignition supply) from position F28 of fuse box.
5. Install and seat 15 amp fuse to position F28 of fuse box.
6. Install and secure engine compartment fuse box cover.
7. Reconnect vehicle battery.
8. Remove fender protector covers.
9. Close hood.

Parts Information:

DESCRIPTION

15 Amp fuse

PART NUMBER

C2S 9936

QTY

1

Warranty Information:

Service Action S918

CURRENT SYSTEM

Warranty claims should be submitted quoting S918 in place of the warranty fault code along with SRO 86 92 95 and the part number for the ignition supply fuse. This will result in a labor time allowance of 0.2 hours to replace the ignition supply fuse.

Should a vehicle be brought back into the workshop for this action alone to be undertaken, an additional labor time allowance of 0.1 hours may be claimed quoting SRO 10 10 10 for drive in/drive out.

<u>SUMMARY</u>	<u>R.O.</u>		<u>TIME</u>
<u>CODE</u>	<u>NUMBER</u>	<u>DESCRIPTION</u>	<u>ALLOWANCE</u>
NP	86.92.95	Replace 30 amp fuse with 15 amp fuse	0.2 hrs.
NT	86.92.95	Replace 30 amp fuse with 15 amp fuse	0.2 hrs.
	10.10.10	Drive in/Drive out	0.1 hrs.

GLOBAL ACES

Upon introduction of the revised DDW claim submission system, the following warranty information will apply.

Warranty claims should be submitted quoting the information found in the table below.

This will result in payment of the stated time and, where applicable parts/miscellaneous expense codes as listed.

Drive in/drive out may only be claimed when the vehicle has been brought in for this action alone to be undertaken.

Program Code	Option	Description	SRO	Time	Description	Part Number	Qty
S918	P	Replace ignition supply fuse	86 92 95	0.2	15 Amp fuse	C2S 9936	1
S918	T	Replace ignition supply fuse	86 92 95	0.2	15 Amp fuse	C2S 9936	1
		Drive in/drive out	10 10 10	0.1			

The SROs and parts listed above have been included for information only, there will be no requirement to enter the parts or SROs onto the claim.

NOTE: Always perform a DCS claim search first to determine whether this service action has been performed on this vehicle. The warranty selection under the vehicle inquiry will give a listing of all claims against the vehicle. If S918 appears in the fault code field, do not perform this service action.

DCS DEALERS

Submit claims using the appropriate summary code for the vehicle model and work performed. Follow standard campaign submission procedures.

NON-DCS DEALERS

Submit claims on the Recall Campaign Summary form W-25. Enter the appropriate summary code for the vehicle model and work performed in the Repair Code column. Do not use the W-1 warranty claim form.