

Luggage Compartment Lid Freezing To Flip Seal – Low Ambient Temperatures – Apply Silicone Lubricant Spray

MODEL 2004 MY-ON
XJ range

VIN G00001-ON

Issue:

On some 2004 MY-ON XJ range vehicles, the luggage compartment lid may freeze to the rear window flip seal in low ambient temperatures.

Action:

In low ambient temperatures, water absorbed by the rear window flip seal may freeze to the luggage compartment lid, resulting in possible damage to the rear window flip seal when the lid is opened. **During the Pre Delivery Inspection (PDI)**, carefully spray silicone lubricant (JLM 21726) onto the surface of the rear window flip seal where it contacts the luggage compartment lid, following the procedure outlined below.

WORKSHOP PROCEDURE

1. Open luggage compartment lid.

⚠ Caution: Protect the paintwork and the surrounding surfaces from over-spray. Wipe-off any excess silicone lubricant.

2. Carefully spray silicone lubricant onto the surface of the rear window flip seal where it contacts the luggage compartment lid. (Illustration 1)
3. Close luggage compartment lid.

REAR WINDOW FLIP SEAL

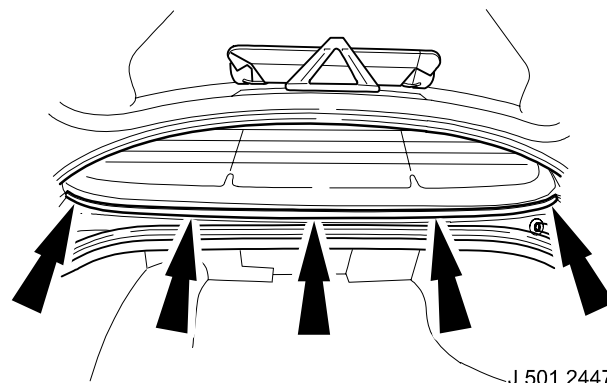


ILLUSTRATION 1

Parts Information:

Loctite Silicone Lubricant (JLM 21726) is considered a workshop consumable and as such may not be claimed.

Warranty Information:

No Warranty information is applicable, PDI includes a suitable labor allowance.