

Squeaks & Rattles – Noise from Wiper Box
& Harness – Install Foam Pad

MODEL 1995 MY
Sedan Range
VIN 720001-ON

ISSUE:

Some 1995 MY Sedan Range vehicles from the above VIN may exhibit a noise from the center of the fascia.

The noise may be caused by contact between the fuel injection harness and the front face of the wiper motor box.

ACTION:

Only in case of a customer complaint of noise as described above on a 1995 MY Sedan Range vehicle within the above VIN range, apply a closed cell foam pad to the wiper motor box as shown in Illustration 1.

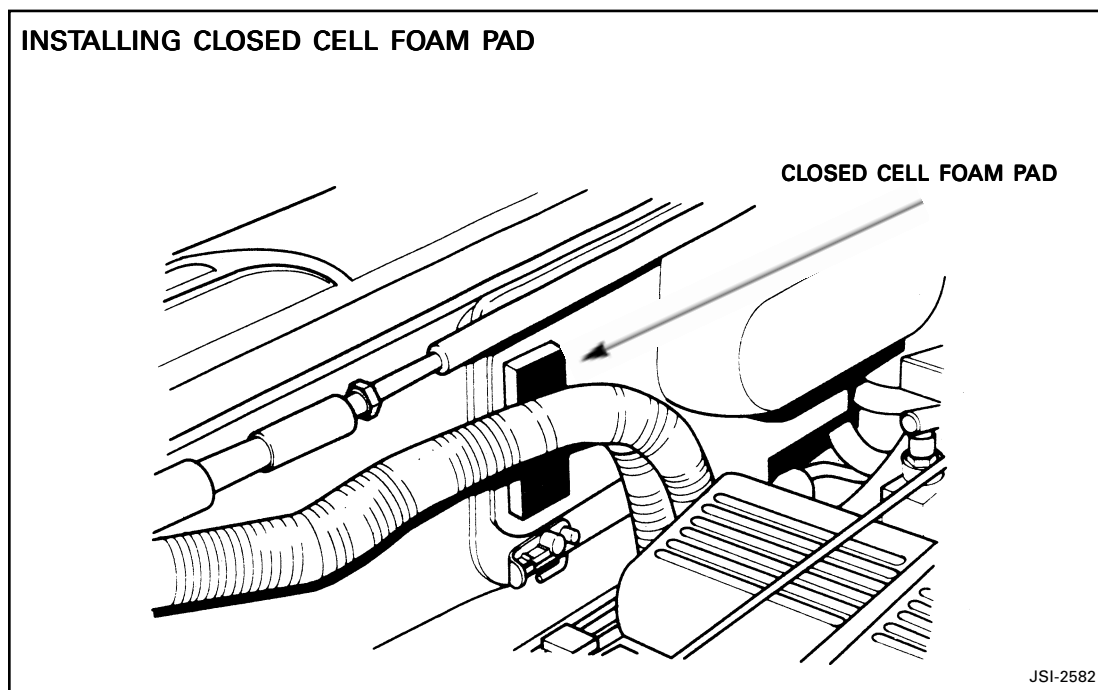


ILLUSTRATION 1

PARTS INFORMATION:

<u>DESCRIPTION</u>	<u>PART NUMBER</u>	<u>QTY</u>
Foam pad (closed cell)	HNA 1210BA	1

WARRANTY INFORMATION:

<u>FAULT CODE</u>	<u>R.O. NUMBER</u>	<u>DESCRIPTION</u>	<u>TIME ALLOWANCE</u>
LG BC MS	76.92.86	Install closed cell foam pad	0.10 hrs.
	10.10.10	Drive in/drive out	0.15 hrs.